

Features

- 1-channel isolated barrier
- 24 V DC supply (loop powered)
- 2- or 3-wire Pt100 RTD input
- Output 4 mA ... 20 mA, temperature linearization selectable
- DIP switch selectable ranges
- Sensor breakage detection


Function

This isolated barrier is used for intrinsic safety applications. It is a loop-powered isolator that converts the resistance from a 3-wire RTD in the hazardous area to a 4 mA ... 20 mA signal in the safe area.

A selectable analog linearization ensures a temperature linear 4 mA ... 20 mA output between 25 °C ... 375 °C.

It also features conveniently located DIP switches, rotary switches and potentiometers to make field calibration easy.


Assembly

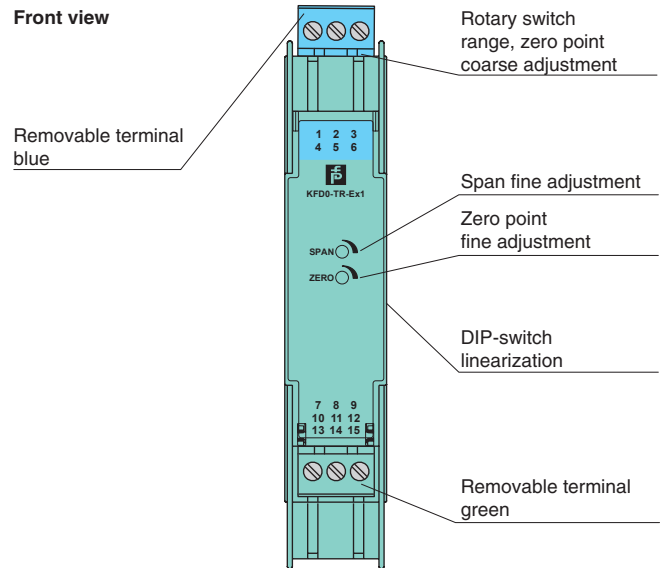

CE



Connection

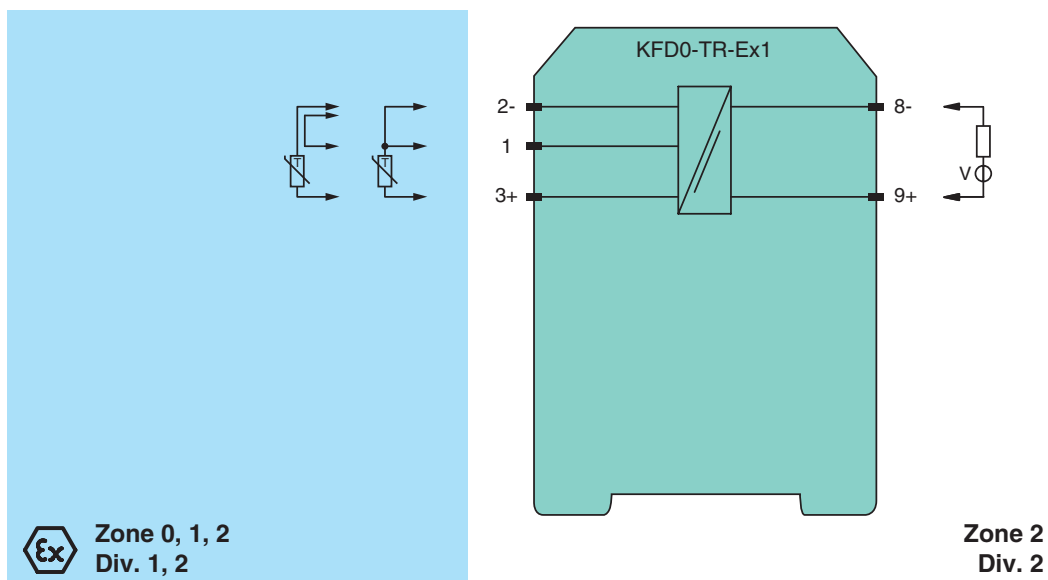

General specifications		
Signal type		Analog input
Supply		
Rated voltage	U_r	12 ... 35 V DC loop powered
Power dissipation		0.4 W
Input		
Connection side		field side
Connection		terminals 1, 2-, 3+ suitable for Pt100, 2- and 3-wire connection
Lead resistance		$\leq 100 \Omega$ per line
Measuring current		approx. 1 mA
Output		
Connection side		control side
Connection		terminals 9+, 8-
Load		(U -12 V) / 0.02 A
Current output		4 ... 20 mA , limited to ≤ 35 mA
Fault signal		upscaling ≥ 22 mA (limited to 35 mA)
Transfer characteristics		
Measurement range	f_n	span without linearization 25 ... 800 °C (77 ... 1472 °F)/with linearization 25 ... 375 °C (77 ... 707 °F), both adjustable zero point without linearization -200 ... 400 °C (-328 ... 752 °F)/with linearization -30 ... 375 °C (-22 ... 707 °F), both adjustable
Deviation		
After calibration		0.1 % of full-scale value incl. linearity and hysteresis
Influence of ambient temperature		span and zero point 0.015 % / K or ± 10 m Ω / K
Influence of supply voltage		6.5 ppm/V
Rise time		250 ms
Galvanic isolation		
Input/Output		available
Indicators/settings		
Control elements		DIP-switch rotary switch
Configuration		via DIP switches via rotary switch
Labeling		space for labeling at the front
Directive conformity		
Electromagnetic compatibility		
Directive 2014/30/EU		EN 61326-1:2013 (industrial locations)
Conformity		
Insulation coordination		EN 50178
Galvanic isolation		EN 50178
Electromagnetic compatibility		NE 21
Degree of protection		IEC 60529
Ambient conditions		
Ambient temperature		-20 ... 60 °C (-4 ... 140 °F)
Mechanical specifications		
Degree of protection		IP20
Connection		screw terminals
Mass		approx. 150 g
Dimensions		20 x 119 x 115 mm (0.8 x 4.7 x 4.5 inch) , housing type B2
Mounting		on 35 mm DIN mounting rail acc. to EN 60715:2001
Data for application in connection with hazardous areas		
EU-Type Examination Certificate		ZELM 00 ATEX 0036
Marking		 II (1)GD [Ex ia] IIC
Voltage	U_o	16.1 V
Current	I_o	33 mA
Power	P_o	131 mW
Type of protection [Ex ia and Ex ib]		
Certificate		TÜV 01 ATEX 1777 X
Marking		 II 3G Ex nA II T4
Galvanic isolation		
Input/Output		safe electrical isolation acc. to IEC/EN 60079-11, voltage peak value 375 V
Directive conformity		
Directive 2014/34/EU		EN 60079-0:2012+A11:2013 , EN 60079-11:2012 , EN 60079-15:2010
International approvals		

Release date 2017-10-20 10:15 Date of issue 2017-10-20 043691_eng.xml

Refer to "General Notes Relating to Pepperl+Fuchs Product Information".

Pepperl+Fuchs Group
www.pepperl-fuchs.com

USA: +1 330 486 0002
pa-info@us.pepperl-fuchs.com


Germany: +49 621 776 2222
pa-info@de.pepperl-fuchs.com

Singapore: +65 6779 9091
pa-info@sg.pepperl-fuchs.com

CSA approval	
Control drawing	116-0132
General information	
Supplementary information	Observe the certificates, declarations of conformity, instruction manuals, and manuals where applicable. For information see www.pepperl-fuchs.com .

Configuration


DIP switches function

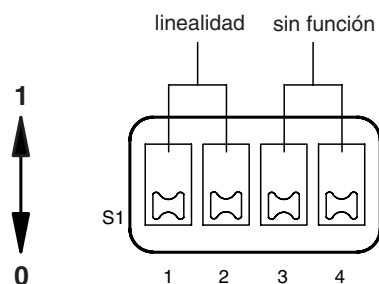

Switch	Position	Function
S1.1	1	Pt100 with linearisation
S1.2	0	(-30 °C ... 375 °C)
S1.1	0	Pt100 without linearisation
S1.2	1	(-200 °C ... 800 °C)

Other combinations of S1.1 and S1.2 are not allowed.

Rotary switches function

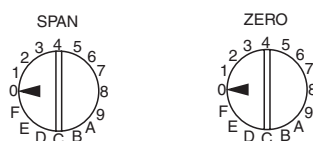

Please consider that both tables contain typical values, which can be used as an adjustment help.

Adjustment range with linearisation					
Switch SPAN (°C) coarse adjustment	D 20 ... 60	6 35 ... 100	2 75 ... 220	1 120 ... 340	0 260 ... 375
Switch ZERO (°C) coarse adjustment					
0	-	-	-	-	-
1	-	-	-	-	-
2	-	-	-	-	-
3	-	-	-	-	-
4	-	-	-	-	-
5	-19 ... 50	-22 ... 45	-30 ... 29	-30 ... 13	-
6	35 ... 103	30 ... 97	16 ... 78	2 ... 61	-30 ... 0
7	87 ... 155	82 ... 148	65 ... 127	48 ... 107	-10 ... 38
8	142 ... 207	134 ... 200	115 ... 177	96 ... 154	28 ... 76
9	192 ... 257	185 ... 249	162 ... 223	141 ... 198	65 ... 111
A	245 ... 306	234 ... 297	209 ... 269	185 ... 242	-
B	290 ... 355	282 ... 344	254 ... 315	-	-
C	338 ... 375	329 ... 375	-	-	-
D	-	-	-	-	-
E	-	-	-	-	-
F	-	-	-	-	-

Adjustment range without linearisation					
Switch SPAN (°C) coarse adjustment	D 25 ... 60	6 40 ... 100	2 90 ... 230	1 140 ... 360	0 320 ... 800
Switch ZERO (°C) coarse adjustment					
0	-	-	-	-	-
1	-200 ... -171	-200 ... -172	-200 ... -176	-200 ... -179	-
2	-183 ... -112	-184 ... -115	-188 ... -122	-191 ... -129	-200 ... -153
3	-126 ... -54	-127 ... -54	-134 ... -67	-140 ... -77	-163 ... -111
4	-68 ... -6	-71 ... 1	-80 ... -12	-90 ... -24	-122 ... -70
5	-9 ... 65	-14 ... 59	-26 ... 42	-38 ... 27	-80 ... -29
6	48 ... 123	43 ... 116	28 ... 97	14 ... 78	-40 ... 12
7	107 ... 182	101 ... 175	82 ... 151	65 ... 130	1 ... 53
8	168 ... 243	160 ... 234	138 ... 208	117 ... 183	43 ... 95
9	226 ... 302	217 ... 292	192 ... 262	168 ... 234	82 ... 135
A	284 ... 361	274 ... 350	246 ... 317	219 ... 285	122 ... 174
B	343 ... 400	331 ... 400	300 ... 372	270 ... 337	162 ... 215
C	-	-	353 ... 400	320 ... 388	201 ... 254
D	-	-	-	37 ... 400	241 ... 293
E	-	-	-	-	279 ... 333
F	-	-	-	-	318 ... 372

Release date 2017-10-20 10:15 Date of issue 2017-10-20 043691_eng.xml

Refer to "General Notes Relating to Pepperl+Fuchs Product Information".

Pepperl+Fuchs Group
www.pepperl-fuchs.com

USA: +1 330 486 0002
pa-info@us.pepperl-fuchs.com

Germany: +49 621 776 2222
pa-info@de.pepperl-fuchs.com

Singapore: +65 6779 9091
pa-info@sg.pepperl-fuchs.com

Recommendation for adjustment:

1. Span determination.
2. "Span coarse adjustment" in accordance with the table (for mode of operation "without linearisation" considering the approx. measurement range start).
3. Minimum value adjustment (in °C) at the input.
4. "Zero point coarse adjustment" to approach to 4 mA.
5. "Zero point fine adjustment" to exactly 4 mA.
6. Maximum value adjustment (in °C) at the input.
7. "Span fine adjustment" to exactly 20 mA.
8. If necessary repeat fine adjustment for 4 mA and 20 mA